

SERVICE BULLETIN



M-1305

September 2, 2011

Transmission Bearing Housing and Oil Pan Torque Specification Changes

Purpose

The purpose of this bulletin is to inform dealers to update service manual literature to reflect torque changes as follows.

Vehicles Affected

The affected vehicles are:

- 2006-2012 Dyna Models
- 2007-2012 Softail, Touring and Touring Police Models
- 2009-2012 Trike Models
- 2006-2012 CVO Touring, Softail and Dyna Models

Markets Affected

All U.S. and non-U.S. markets where Dyna, Softail and Touring models are sold.

Required Dealer Action

Update all affected service manuals with the following torque changes. Torque sequences remain unchanged.

Table 1. Torque Specification Update

FIGURE	YEAR	MODEL	FASTENER	TORQUE
Figure 1	2006-2012	Dyna	Transmission bearing housing screws	23-25 ft-lbs (31.2-33.9 Nm)
Figure 1	2007-2012	Softail	Transmission bearing housing screws	23-25 ft-lbs (31.2-33.9 Nm)
Figure 1	2007-2012	Touring	Transmission bearing housing screws	23-25 ft-lbs (31.2-33.9 Nm)
Figure 2	2006-2012	Dyna	Oil pan screws	132-156 in-lbs (14.9-17.6 Nm)
Figure 2	2007-2012	Touring	Oil pan screws	132-156 in-lbs (14.9-17.6 Nm)

NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO. 1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
INITIAL HERE									

©2011 H-D

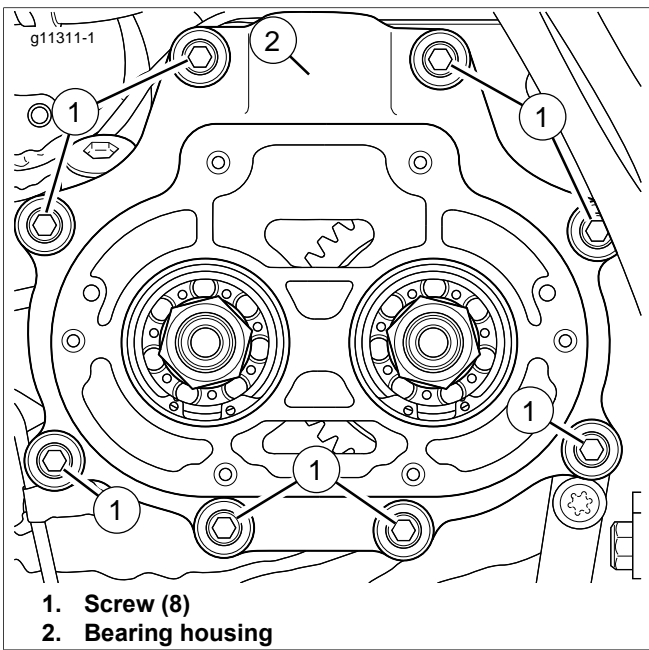


Figure 1. Transmission Bearing Housing Screws

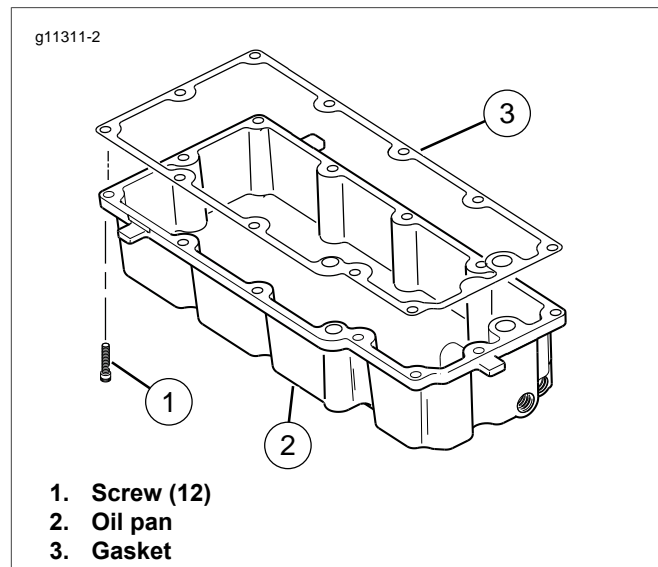


Figure 2. Oil Pan screws